

# Compliance Noise Monitoring

Byron Resource Recovery Centre  
The Manse Road  
Myocum



# Compliance Noise Monitoring

Byron Resource Recovery Centre  
The Manse Road  
Myocum

Prepared for: Byron Shire Council  
Project: 14/2017  
Version 1.0  
Date: 15 September 2017  
Tim Fitzroy & Associates  
ABN: 94120188829  
ACN: 120188829

environmental

tim

**fitzroy & associates**

environmental health | environmental education | environmental auditing

52 Alston Avenue  
Alstonville NSW 2477  
T | 02 6628 3837  
F | 02 6628 1349  
M | 0448 483 837  
[tim@timfitzroy.com.au](mailto:tim@timfitzroy.com.au)  
[www.timfitzroy.com.au](http://www.timfitzroy.com.au)

# TABLE OF CONTENTS

<b>Section</b>	<b>Page</b>
<b>1. INTRODUCTION .....</b>	<b>5</b>
1.1 Purpose.....	5
1.2 Site Description and Surrounds.....	5
<b>2. RESOURCE RECOVERY OPERATIONS .....</b>	<b>6</b>
2.1 Typical Operations .....	6
2.2 Intermittent Operations.....	6
2.3 Licence Conditions .....	7
<b>3. NOISE ASSESSMENT .....</b>	<b>10</b>
3.1 Acoustical Equipment.....	10
3.2 Monitoring Methodology .....	10
3.3 Noise Monitoring Results .....	11
3.4 Observations .....	12
<b>4. CONCLUSIONS &amp; RECOMMENDATIONS .....</b>	<b>14</b>

## Illustrations

Illustration 2.1 Noise Monitoring Locations and Dwelling Setbacks.....	9
--	---

## Tables

Table 2.1 Noise Monitoring Locations 30m from dwellings .....	7
Table 3.1 Monitoring Results at N1 to N5 under Normal Operating Conditions	11

## Appendices

A Photographs .....	15
---------------------	----

# 1. Introduction

## 1.1 Purpose

Tim Fitzroy & Associates were engaged by Byron Shire Council (BSC) to undertake an operational noise assessment at the Byron Resource Recovery Centre (BRRC) (former Myocum Landfill), The Manse Road Myocum. Key components of the noise assessment were to:

- undertake compliance noise monitoring; and
- provide an updated noise assessment of site operations.

Compliance noise monitoring was undertaken on 30 August 2017.

## 1.2 Site Description and Surrounds

The subject site is described as Lot 1 DP 1052900 The Manse Road, Myocum. The BRCC is established between two remnant ridgelines. The BRCC is located at Myocum around 6km south of Mullumbimby and 9km southwest of Brunswick Heads. The Myocum quarry is located to the west of the site.

The new Resource Recovery Area is located on the crest of a hill. The surrounding area is undulating.

A number of residences are within close proximity of the BRCC. Residences R1 to R5 (inclusive) are identified in **Illustration 2.1**. Residences R1, R3 and R4 are owned by BSC, while the other residences are privately owned. Residences R1 and R5 are two storey dwelling houses while the other dwellings are single storey.

A BSC operated quarry is located to the immediate west of the BRCC, while Leela Quarry (privately operated) is located to the north (see **Illustration 2.1**). Vegetation provides a visual screen from the BRCC to residences R1, R2, R3 and R5.

## 2. Resource Recovery Operations

### 2.1 Typical Operations

Waste Recovery and Recycling operations are carried out in the transfer centre, green-waste and resource recovery areas. The Byron Resource Recovery Centre operating hours are 7:30 am to 4:00pm (Monday to Friday) and 8:00am to 12:00pm (Saturday and Sunday). Landfilling operations ceased in late September 2013. Additional infrastructure has been installed at the existing transfer station for the temporary storage and bulk transfer of waste to South east Queensland. A new Resource Recovery Area has been established on a level area between the redundant northern and southern landfill cells.

Council operates a single body, dual axle, hook lift truck for the purpose of transporting water for dust suppression, emergency spot fire fighting and moving various waste and recyclable products within the site within hook lift bins. Council operates a Backhoe (Cat 432D) for the management of recyclable stockpiles within the resource recovery area, including the loading of lift hook bins, transferring materials to the tip shop and loading small quantities of mulch for customers. Waste is deposited into bins using private or commercial vehicles. The bins are emptied by transfer trucks.

A variety of vehicles including: private vehicles, mini skips, council rubbish trucks (up to 8 per day) deposit waste either at the transfer station or the resource recovery area. Semi-trailers operate in the Resource Recovery area with roll-on roll-off bins. Walking floor trucks operate in the transfer station. Average movements are twice a day, Monday to Friday.

To the north of the face are the weighbridge, waste transfer centre and second hand shop. This area is not in a direct line of site to residences R1, R2, R4 and R5.

### 2.2 Intermittent Operations

Intermittent noise generating activities include green waste mulching and metal collection/ baling. Based on current throughput green waste mulching occurs on a 6 weekly basis; metal collection/baling once every 2 weeks.

The following corrective actions are employed by BSC to reduce noise impacts from intermittent noise generating activities:

- Green waste and metal processing does not occur on weekends and public holidays;
- Commencement of these operational activities shall take place on weekdays only, commencing no earlier than 9:00 a.m. and ceasing no later than 4:00 p.m.;
- Dates for these operational activities will be scheduled at least two weeks in advance of commencement, and potentially affected resident neighbours will be notified by a letter box drop and/or a roadside message board.

### 2.3 Construction

During noise monitoring on 30 August 2017 construction for the building pad for the new composting pad was underway in the Resource Recovery Area. Construction

equipment included Possi-trac loader and Roller Compactor plus B Double (truck and dogs periodically delivering material).

## 2.4 Licence Conditions

The NSW Environment Protection Authority (EPA) has issued licence conditions for the Myocum Landfill site. Noise Monitoring locations are to be located within 30m of Residence R1 to R5 (inclusive) are identified in **Table 2.1**.

Condition L6.1 states that the Project Specific Noise Limits (PSNL) Laeq (15 minute) are:

- 43 dB(A) at monitoring points 20 (N1), 21 (N2), 27 (N4) and 28 (N5); and
- 39 dB (A) at monitoring point 22 (N3).

**Table 2.1 Noise Monitoring Locations 30m from dwellings**

Location	Description	Distance from BRCC (m)
N1	Council owned house, 127 Manse Rd, southeast of BRCC	200
N2	Private House, 110 Manse Road, south of BRCC	300
N3	Council owned house, 1 Dingo lane, west of quarry and BRCC	700
N4	Council owned house, 147 The Manse Road, east of BRCC	200
N5	Private house, 149 Manse Road, south east of BRCC	250

The  $L_{Aeq}$  is essentially the average sound level. It is defined as the steady sound level that contains the same amount of acoustical energy at a given time; varying sound over a defined measurement period.

In accordance with the NSW Industrial Noise Policy (INP) (NSW EPA 2000), the Myocum Waste and Recycling facility is classified as an industrial/commercial noise source. The assessment procedure for an industrial noise source should comprise of:

- Controlling intrusive noise impacts in the short term for surrounding residences; and
- Maintaining noise level amenity for particular land uses for residences and other land uses.

In assessing the noise impact of the Byron Resource Recovery Centre on the surrounding land use, both components must be taken into account for residential receivers, but, in most cases, only one will become the limiting factor forming the project-specific noise level. The intrusiveness of an industrial noise source may be generally considered to be acceptable if the equivalent continuous A-weighted level of noise from the source, measured over a 15 minute period, does not exceed the background noise level by more than 5dB. Therefore, the limiting criteria for the control of intrusive noise impacts is if the  $L_{Aeq,15\text{ minute}}$  descriptor is  $< RBL + 5\text{ dB}$ .

In accordance with the INP, the project specific noise criteria is the lesser of either the amenity or intrusiveness criterion. The work to derive the PSNL was carried out previously, endorsed by the EPA and has resulted in the licence conditions imposed.

Condition No. L6.2 states that noise compliance is to occur within 30m of each nominated residence. Noise Monitoring locations are depicted in **Illustration 2.1**.





**Dwelling setback distances from Myocum Landfill**

R1	70m
R2	240m
R3	650m
R4	140m
R5	180m

*Note: Distances are approximate only.*



0 80m

SCALE: 1:4000 (A3)  
DRAWN: azaCAD.com.au  
BASE SOURCE: GOOGLE MAPS  
DATE: MAY 2014  
REFERENCE: 22-99-C

**Illustration 2.1:**  
**Noise Monitoring Locations and Dwelling Setbacks**

## 3. Noise Assessment

### 3.1 Acoustical Equipment

Tim Fitzroy & Associates utilised the following equipment in this Noise Impact Assessment:

- A Type 2 Rion NL-22 environmental sound level meter.

Calibration of the noise monitoring equipment was undertaken prior to use. To ensure no significant tonal drift occurred over the monitoring period, the calibration was checked before and after each measurement period.

### 3.2 Monitoring Methodology

Noise monitoring was undertaken during typical resource recovery operations.

*Typical operations* include the operation of the backhoe and unloading activities at the transfer station and resource recovery area plus vehicular movements.

*Atypical operations:* include the construction for the building pad for the new composting pad was underway in the Resource Recovery Area. Construction equipment included Possi-trac loader and roller compactor plus B Double (truck and dogs periodically delivering material).

Ambient sound pressure levels were measured generally in accordance with Australian Standard AS1055.1:1997 - '*Acoustics-Description and measurement of environmental noise - Part 1: General procedures*'. The monitoring locations reflect as much as possible the requirement for monitoring at the most affected point within 30m of each dwelling.

Noise monitoring was carried out on Wednesday 30 August 2017 between 8:00am and 12:00pm.

One 15 minute sample was obtained at each of the monitoring locations using a Larson Davis, type 1 Sound Level Meter. The Fast and A weighting settings were used. The microphone at each location was 1.35m above ground level.

The weather during the noise monitoring was fine. Winds conditions ranged from calm to moderate nor westerly winds.

**Illustration 2.1** shows the location of the noise monitoring locations and set back distances from residences R1 to R5 inclusive to the BRCC.

Photographs of the noise monitoring locations, N1 to N5, transfer station and resource recovery operations are provided in **Appendix A**.

### 3.3 Noise Monitoring Results

- The noise monitoring results (nmr) are provided in Table 3.1.

During normal operations the main sources of noise at the BRCC was the loader operation in the resource recovery area and in the transfer area. Other sources of noise included construction noise from the Possi-trac loader and a Roller Compactor undertaking earthworks for the new compost building pad in the Resource Recovery Area and vehicle entering and leaving the BRCC and vehicle movements on the site and along The Manse Road. Environmental noise including crows and cicadas was significant in some locations. During monitoring wind speed varied from calm up to 18km/hr from the North West

**\*Note:** Construction noise impacts where audible have been excluded from estimated BRCC noise contribution

**Table 3.1 Monitoring Results at N1 to N5**

Date	Location	Time	Measured L <sub>Aeq(15min)</sub> dB(A)	*Estimated BRCC Contribution	Comments	Licence Condition dB(A)
30/08/2017	N1	8:15-8:45	51	45	Primary noise operation of construction equipment.  Secondary noise loader operation in Resource Recovery Area Crow calls, Cicadas, Vehicle entering and leaving	43
30/08/2017	N2	10:45-11:15	54	<35	No impact from BRCC (not audible) Main source vehicles travelling along The Manse Road, limited crow	43

					calls	
30/08/2017	N3	11:30-12:00	44	<35	BRRC not audible Primary noise associated with rustling of wind in trees. Wind elevated to 18km/hr from north west during monitoring	39
30/08/2017	N4	9:00-9:30	53	47	Primary noise operation of construction equipment. Secondary noise loader at RRA and crow calls	43
30/08/2017	N5	9:45 - 10:15	58	39	Principal noise farm machinery on adjacent farm , Bird calls, BRRC barely audible with exception of occasional deposition of material in RRA.	43

Note: Full noise monitoring results are located in **Appendix B**.

## 3.4 Observations

### 3.4.1 Typical Operations at N1 to N5

At location N1, the measured LAeq was 51 dB (A). The dominant noise was the Construction equipment for the construction of the new compost pad. Secondary noise included the loader operation in the Resource Recovery Area and the sound of vehicles entering and leaving the BRRC. Other noises included crow calls.

The measured LAeq of 51 dB (A) is 8 dB (A) above the noise limit of 43 dB (A). The estimated contribution from Resource Recovery Operations was 45 dB (A). The residence, R1 is owned by BSC, the operator of the Byron Resource Recovery Centre.

At location N2, the measured LAeq was 54dB (A). N2 was affected by traffic noise primarily associated with the Byron Resource Recovery Centre, wind impacts around 18km/hr and bird calls. Noise from the Byron Resource Recovery operation was not audible and estimated <35 db (A). This is below the noise limit of 43 dB (A).

At location N3, the measured LAeq was 44dB (A). During the monitoring period the BRRRC was not audible. The primary noise source was wind resulting in trees and bird calls. The estimated contribution from Resource Recovery Operations was <35 dB (A). This is below the noise limit of 39dB (A). The residence, R3 is owned by BSC, the operator of the Byron Resource Recovery Centre.

At location N4, the measured LAeq was 53dB (A) with the dominant noise being construction equipment. Secondary noises included loader operating in the Resource Recovery Area and crow calls. Noise estimated from Resource Recovery operations account for 47 dB (A). This is 4 dB (A) above the noise limit of 43dB (A). The residence, R4 is owned by BSC, the operator of Byron Resource Recovery Centre.


At location N5, the measured LAeq was 58dB (A). The measurement was wind impacted. The Resource Recovery Facility operations were not audible, with exception of occasional deposition of material in RRA. In the absence of environmental noises and vehicular traffic along the Manse Road the Resource Recovery Facility operations noise level was 39 dB (A) and therefore in compliance with the noise limit.

## 4. Conclusions & Recommendations

It is concluded from the noise monitoring carried out on 30 August 2017 that:

- The noise limit at location N1 exceeded the noise limit of 43 dB(A) by 2dB;
- The noise limit at location N2 was compliant with the noise limit of 43 dB(A);
- The noise limit at location N3 was compliant with the noise limit of 39 dB(A);
- The noise limit at location N4 exceeded the noise limit of 43 dB(A) by 4 dB; and
- The noise limit at location N5 was compliant with the noise limit of 43 dB (A).

Residence R1, R3 and R4 are owned by Byron Shire Council.

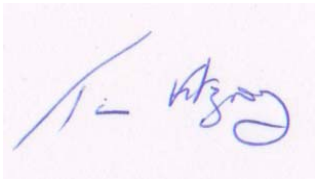

**Tim Fitzroy**  
Environmental Health Scientist  
Environmental Auditor

# References

- NSW DECC, 2009      Noise Guide for Local Government, Department of Environment,  
Climate Change & Water, Sydney
- NSW EPA, 2000      Industrial Noise Policy. Environmental Protection Authority,  
Sydney

# Copyright and Usage

©Tim Fitzroy and Associates 2017

This document was prepared for the exclusive use of Byron Shire Council and is not to be used for any other purpose or by any other person or corporation. Tim Fitzroy and Associates accepts no responsibility for any loss or damage suffered howsoever arising to any person or corporation who may use or rely on this document for a purpose other than that described above.

Plans accompanying this document may not be reproduced, stored or transmitted in any form unless this note is included.

Tim Fitzroy and Associates declares that does not have, nor expects to have, a beneficial interest in the subject project.

No extract of text of this document may be reproduced, stored or transmitted in any form without the prior consent of Tim Fitzroy and Associates.



# A Photographs



**Photo A**      **Transfer Station**



**Photo B**      **Resource Recovery Area**



**Photo C**      **Noise Monitoring Location (N1)**



**Photo D**      **Noise Monitoring Location (N2)**



**Photo E**      **Noise Monitoring Location (N3)**



**Photo F      Noise Monitoring Location (N4)**



**Photo G      Noise Monitoring Location (N5)**

## B Noise Data

Address	Time	Measurme Time		LAeq	LAE	LAmx	LAmn	LA01	LA10	LA50	LA90	LA95	LCpeak	Over	Under	Pause
1	30/08/2017	8:15:00	0:15:00	51.2	80.7	69.4	31	64.1	53.3	39.3	34.4	33.8	94.3	-	-	-
2	30/08/2017	8:30:00	0:15:00	51.5	81	72.7	33.4	64.6	52.9	43.9	38.8	37.8	85.3	-	-	-



Address	Time	Measurme Time	LAeq	LAE	LAmx	LAmn	LA01	LA10	LA50	LA90	LA95	LCpeak	Over	Under	Pause
1	30/08/2017	11:30:00	0:15:00	47	76.6	67.4	33.3	57.7	50.6	40.7	36.4	35.5	85.7	-	-
2	30/08/2017	11:45:00	0:15:00	41.6 44.3	71.2	71.5	30.2	50.5	42.7	38.5	34.1	33.2	101.2	-	-





